QG series

DIS sensors

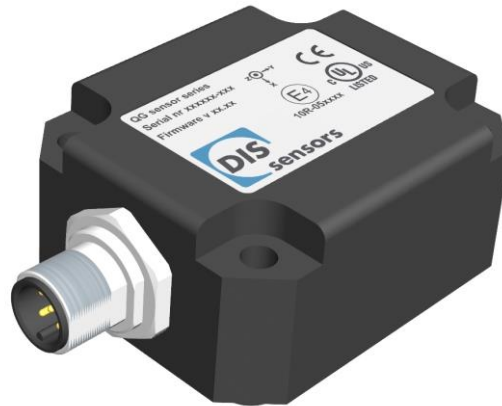QG65-KI-360H-AV-CM

Inclination sensor
1 axis vertical mounting

Factory programmable device
Output: 0,5 - 4,5 V

Measuring range programmable
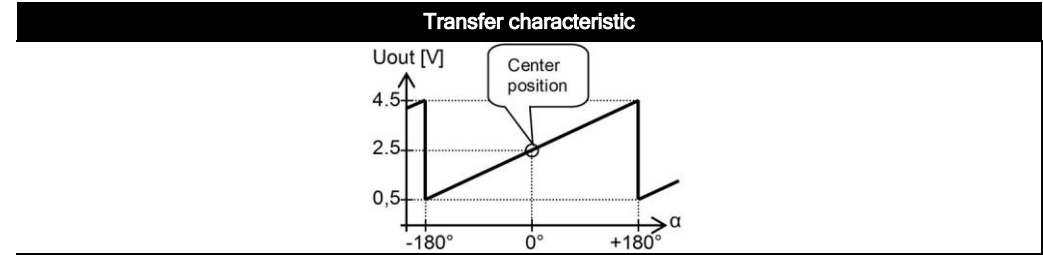between 1° and 360°

Measuring range
Factory default: ±180°

CE

General specifications 11625, v20210921	
Housing	Reinforced plastic injection molded (Faradex DS, black, EMI shielded by stainless steel fiber in PC)
Dimensions (indicative)	60x50x27 mm
Mounting	Included: 4x M5x25 mm zinc plated steel pozidrive pan head screws, self-tapping (PZ DIN7500CZ) Mounting on flat surface only. Screw crosswise with maximum Torque 2.5 Nm
Ingress Protection (IEC 60529)	IP67, IP69K (with IP69K mating connector)
Relative humidity	0 - 95% (non condensing, housing fully potted)
Weight	approx. 110 gram
Supply voltage	8 - 30 V dc
Polarity protection	Yes
Current consumption	≤ 25 mA
Operating temperature	-40 .. +85 °C
Storage temperature	-40 .. +85 °C
Measuring range	Factory default: ±180°
Centering function	Yes (2,5 V = 0°), range 360°
Frequency response (-3dB)	0 - 10 Hz
Accuracy (overall @20°C)	0,07° typ.
Offset error	± 0,03° typ. (± 0,08° max) after centering
Non linearity	± 0,06° typ., ± 0,1° 2σ, ± 0,15° max.
Sensitivity error	not applicable. Repeatability 0,05°
Resolution	0,01°
Temperature coefficient	± 0,005°/K typ.
Max mechanical shock	20.000g
Output	0,5 - 4,5 V
Output load	Rload ≥20kΩ, Cload ≤20 nF
Short circuit protection	Yes (max 10 s)
Output refresh rate	20 ms
Programming options	Factory programmable (measuring range, filtering)

QG series

QG65-KI-360H-AV-CM

Uout = 2,5 + 2*(α/180) [V]

Transfer characteristic

Uout [V]

Center position

4.5
2.5
0,5

-180°   0°   +180°   α

Measurement orientation

Rotation in vertical plane.

Lateral tilt sensitivity error:
< ± 0,03°/° lateral tilt (typ.)
Max. lateral tilt: 45°
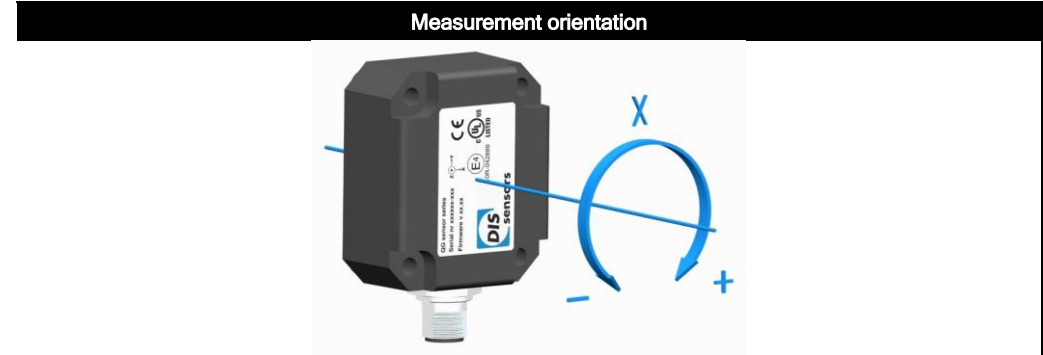
Connectivity (cable length ±10%)

Connection	M12 male 8p A-coding connector (Brass Nickel coated, contacts copper alloy)

Wire / pin coding

Pin 1:	Output for factory use only
Pin 2:	Supply voltage
Pin 3:	for factory use only
Pin 4:	for factory use only
Pin 5:	Gnd
Pin 6:	Centering input
Pin 7:	Output
Pin 8:	not connected

Mechanical dimensions (indicative only)
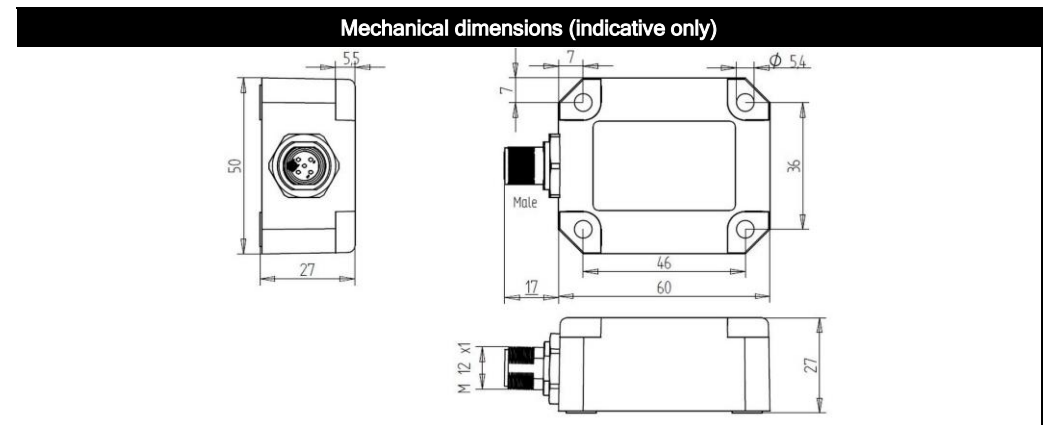
Center function

Centering can be done to eliminate mechanical offsets. To execute centering connect center input to ground (>0,5sec) within 1 min. after power up. After centering you have 1 min. left for another centering. Normally the center input should be left unconnected.

Optional: for accurate mounting two factory mounted positioning pins can be mounted (Ø4mm) replacing 2x M5x25 mm.

As this device is accelerometer-based the sensor is inherent sensitive for accelerations/vibrations. Application specific testing must be carried out to check whether this sensor will fulfil your requirements.